


INFORMATION ONLY



NOTE: Hearth Tiles CUT AND INSTALLED by others

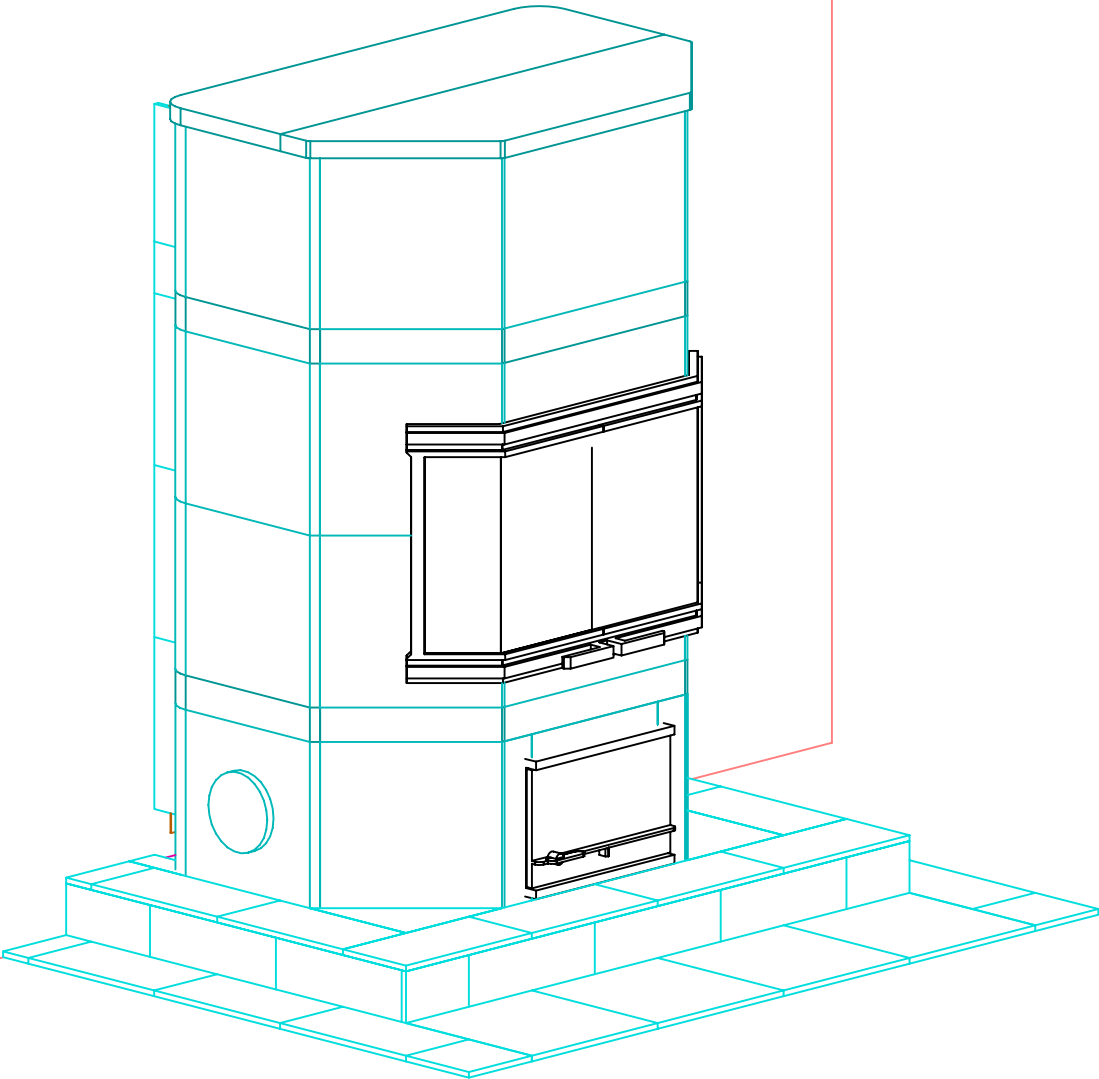

MID-ATLANTIC MASONRY HEAT
1229 Harris Street Suite 1
Charlottesville, VA 22903
(434)979-9709 Fax 434-979-6416

PROJECT GLEASON
MODEL TU1230


CONTRACT 5712
DRAWN BY D.P.BYRAM

VIEW PERSPECTIVE
DATE 3/09/05

PAGE 1

FRONT VIEW

INFORMATION ONLY

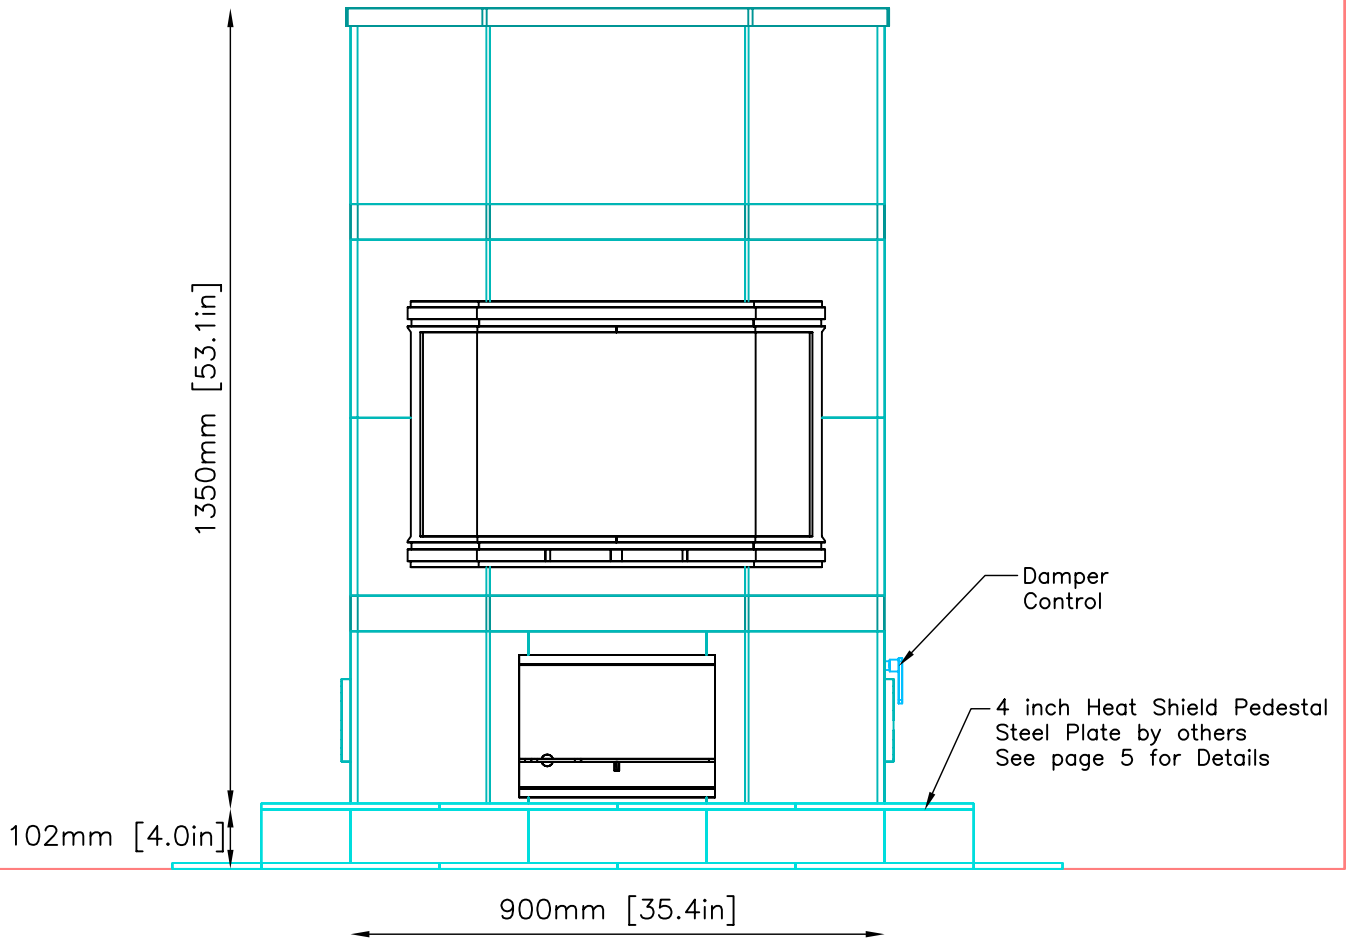

MID-ATLANTIC MASONRY HEAT
1229 Harris Street Suite 1
Charlottesville, VA 22903
(434)979-9709 Fax 434-979-6416

PROJECT GLEASON
MODEL TU1230


CONTRACT 5712
DRAWN BY D.P.BYRAM

VIEW FRONT
DATE 3/09/05

PAGE


2

SIDE VIEW

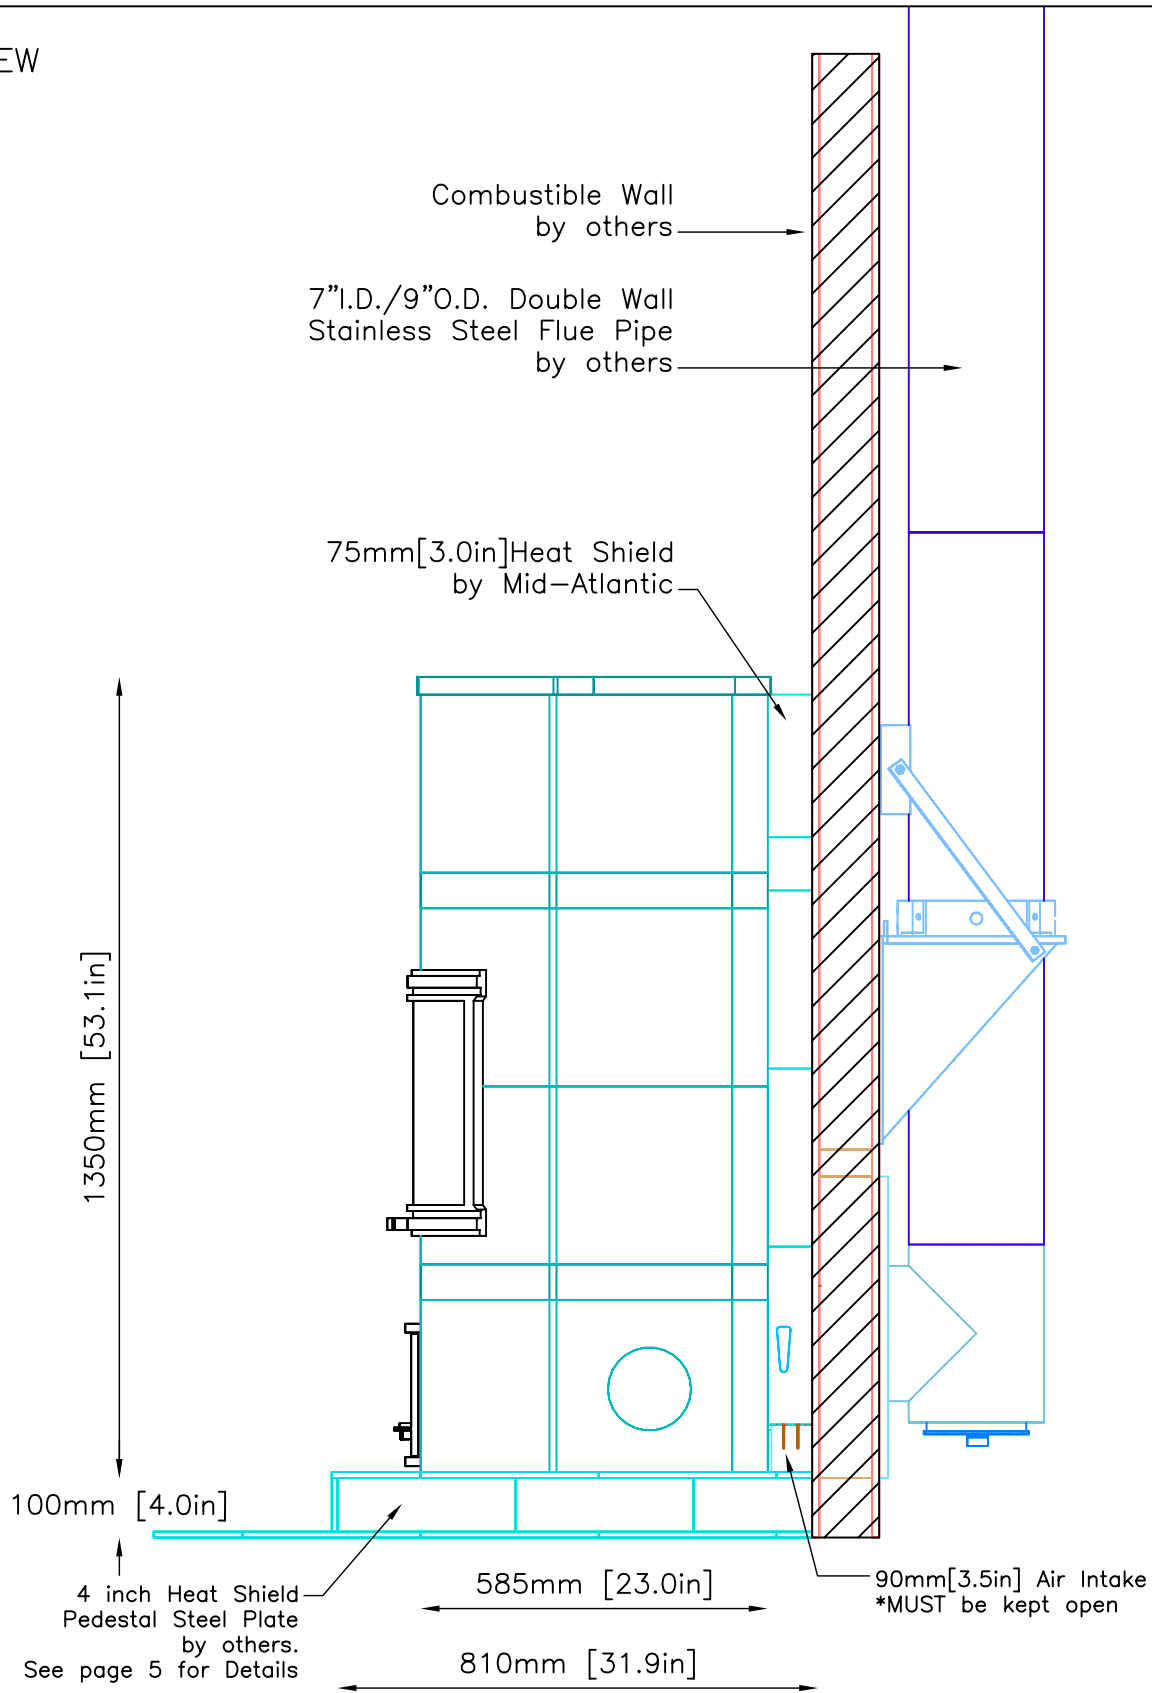

INFORMATION ONLY

PLAN VIEW

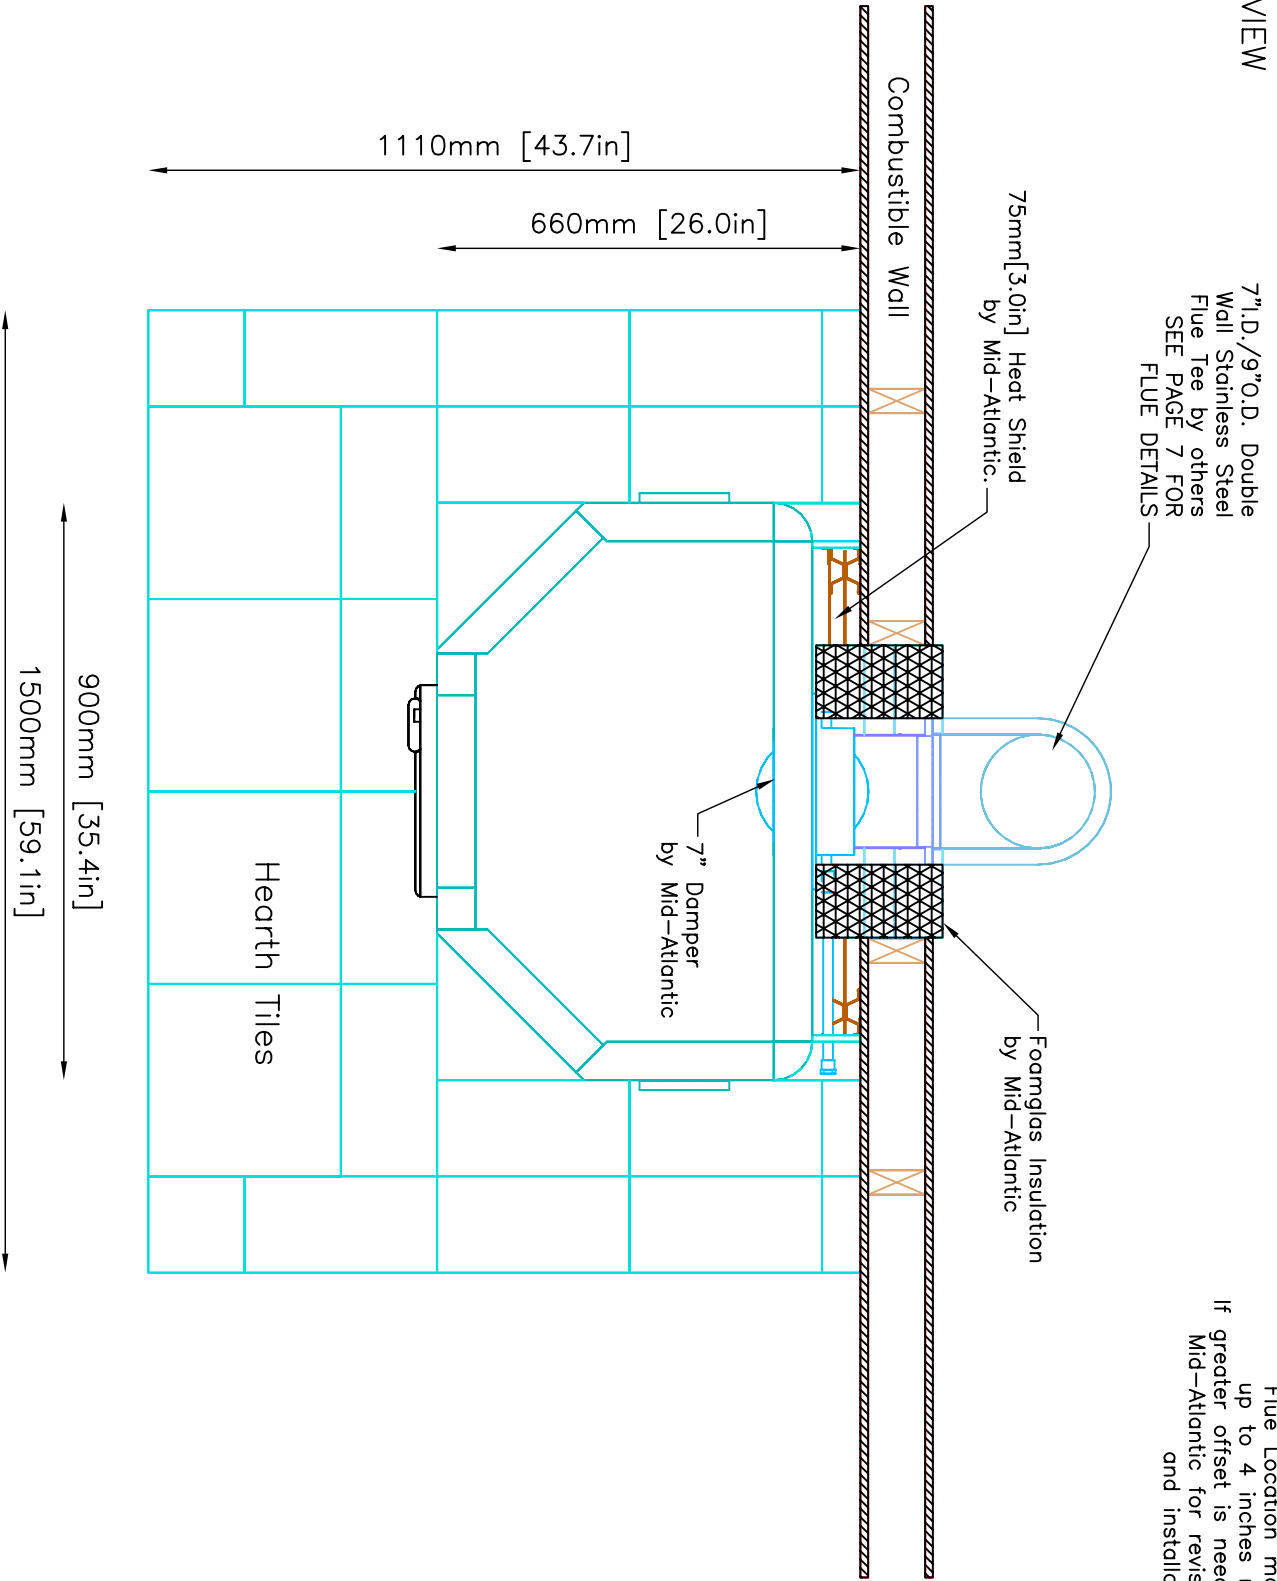

7"1.D./9"O.D. Double Wall Stainless Steel Flue Tee by others SEE PAGE 7 FOR FLUE DETAILS

Flue Location may be offset up to 4 inches right or left. If greater offset is needed, contact Mid-Atlantic for revised drawings and installation pricing.

NOTE: Hearth Tiles CUT AND INSTALLED by others


INFORMATION ONLY

	MID-ATLANTIC MASONRY HEAT 1229 Harris Street Suite 1 Charlottesville, VA 22903 (434)979-9709 Fax 434-979-6416	PROJECT	GLEASON	CONTRACT	5712	VIEW	PLAN	PAGE 4
		MODEL	TU1230	DRAWN BY	D.P.BYRAM	DATE	3/09/05	

STEEL PLATE PEDESTAL
 3/4" STEEL PLATE-BY OTHERS

INFORMATION ONLY


NOTE:
 STEEL PLATE TO BE LEVEL
 Tolerances:
 +/- 1/8" No addition cost to adjust
 steel plate
 +/- 1/4" \$150.00-\$200.00 additional
 cost to adjust steel plate
 +/- 1/2" \$500.00 additional cost
 to adjust steel plate

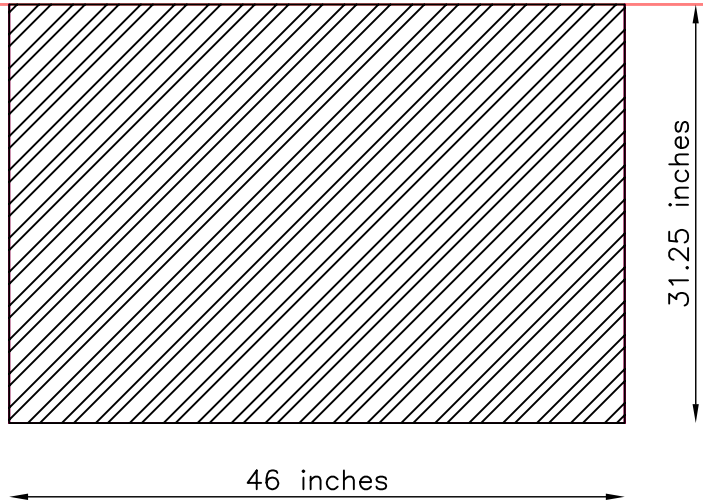

UNIT WEIGHT: 3,200lbs.

Owner/Contractor is responsible for engineering steel plate to support weight of fireplace, as specified above, without deflection.

Note: Bottom of 3/4" Steel Plate can rest on sub-floor but MUST be Level.

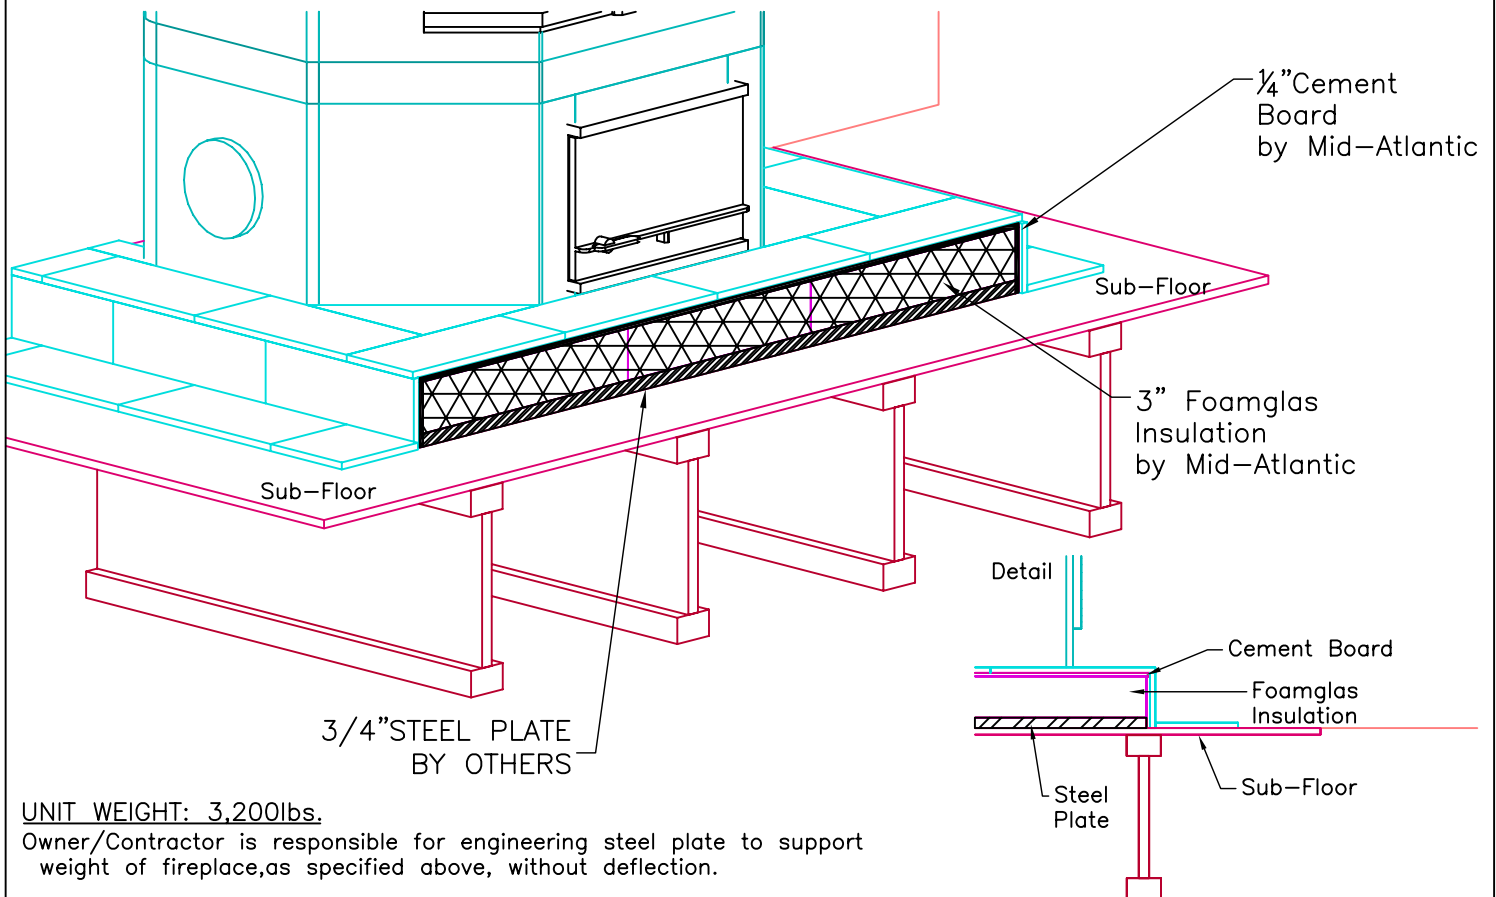

UNIT WEIGHT: 3,200lbs.

Owner/Contractor is responsible for engineering steel plate to support weight of fireplace, as specified above, without deflection.



MID-ATLANTIC MASONRY HEAT
 1229 Harris Street Suite 1
 Charlottesville, VA 22903
 (434)979-9709 Fax 434-979-6416

PROJECT GLEASON
 MODEL TU1230

CONTRACT 5712
 DRAWN BY D.P.BYRAM

VIEW SUPPORT
 DATE 3/09/05

PAGE 5